


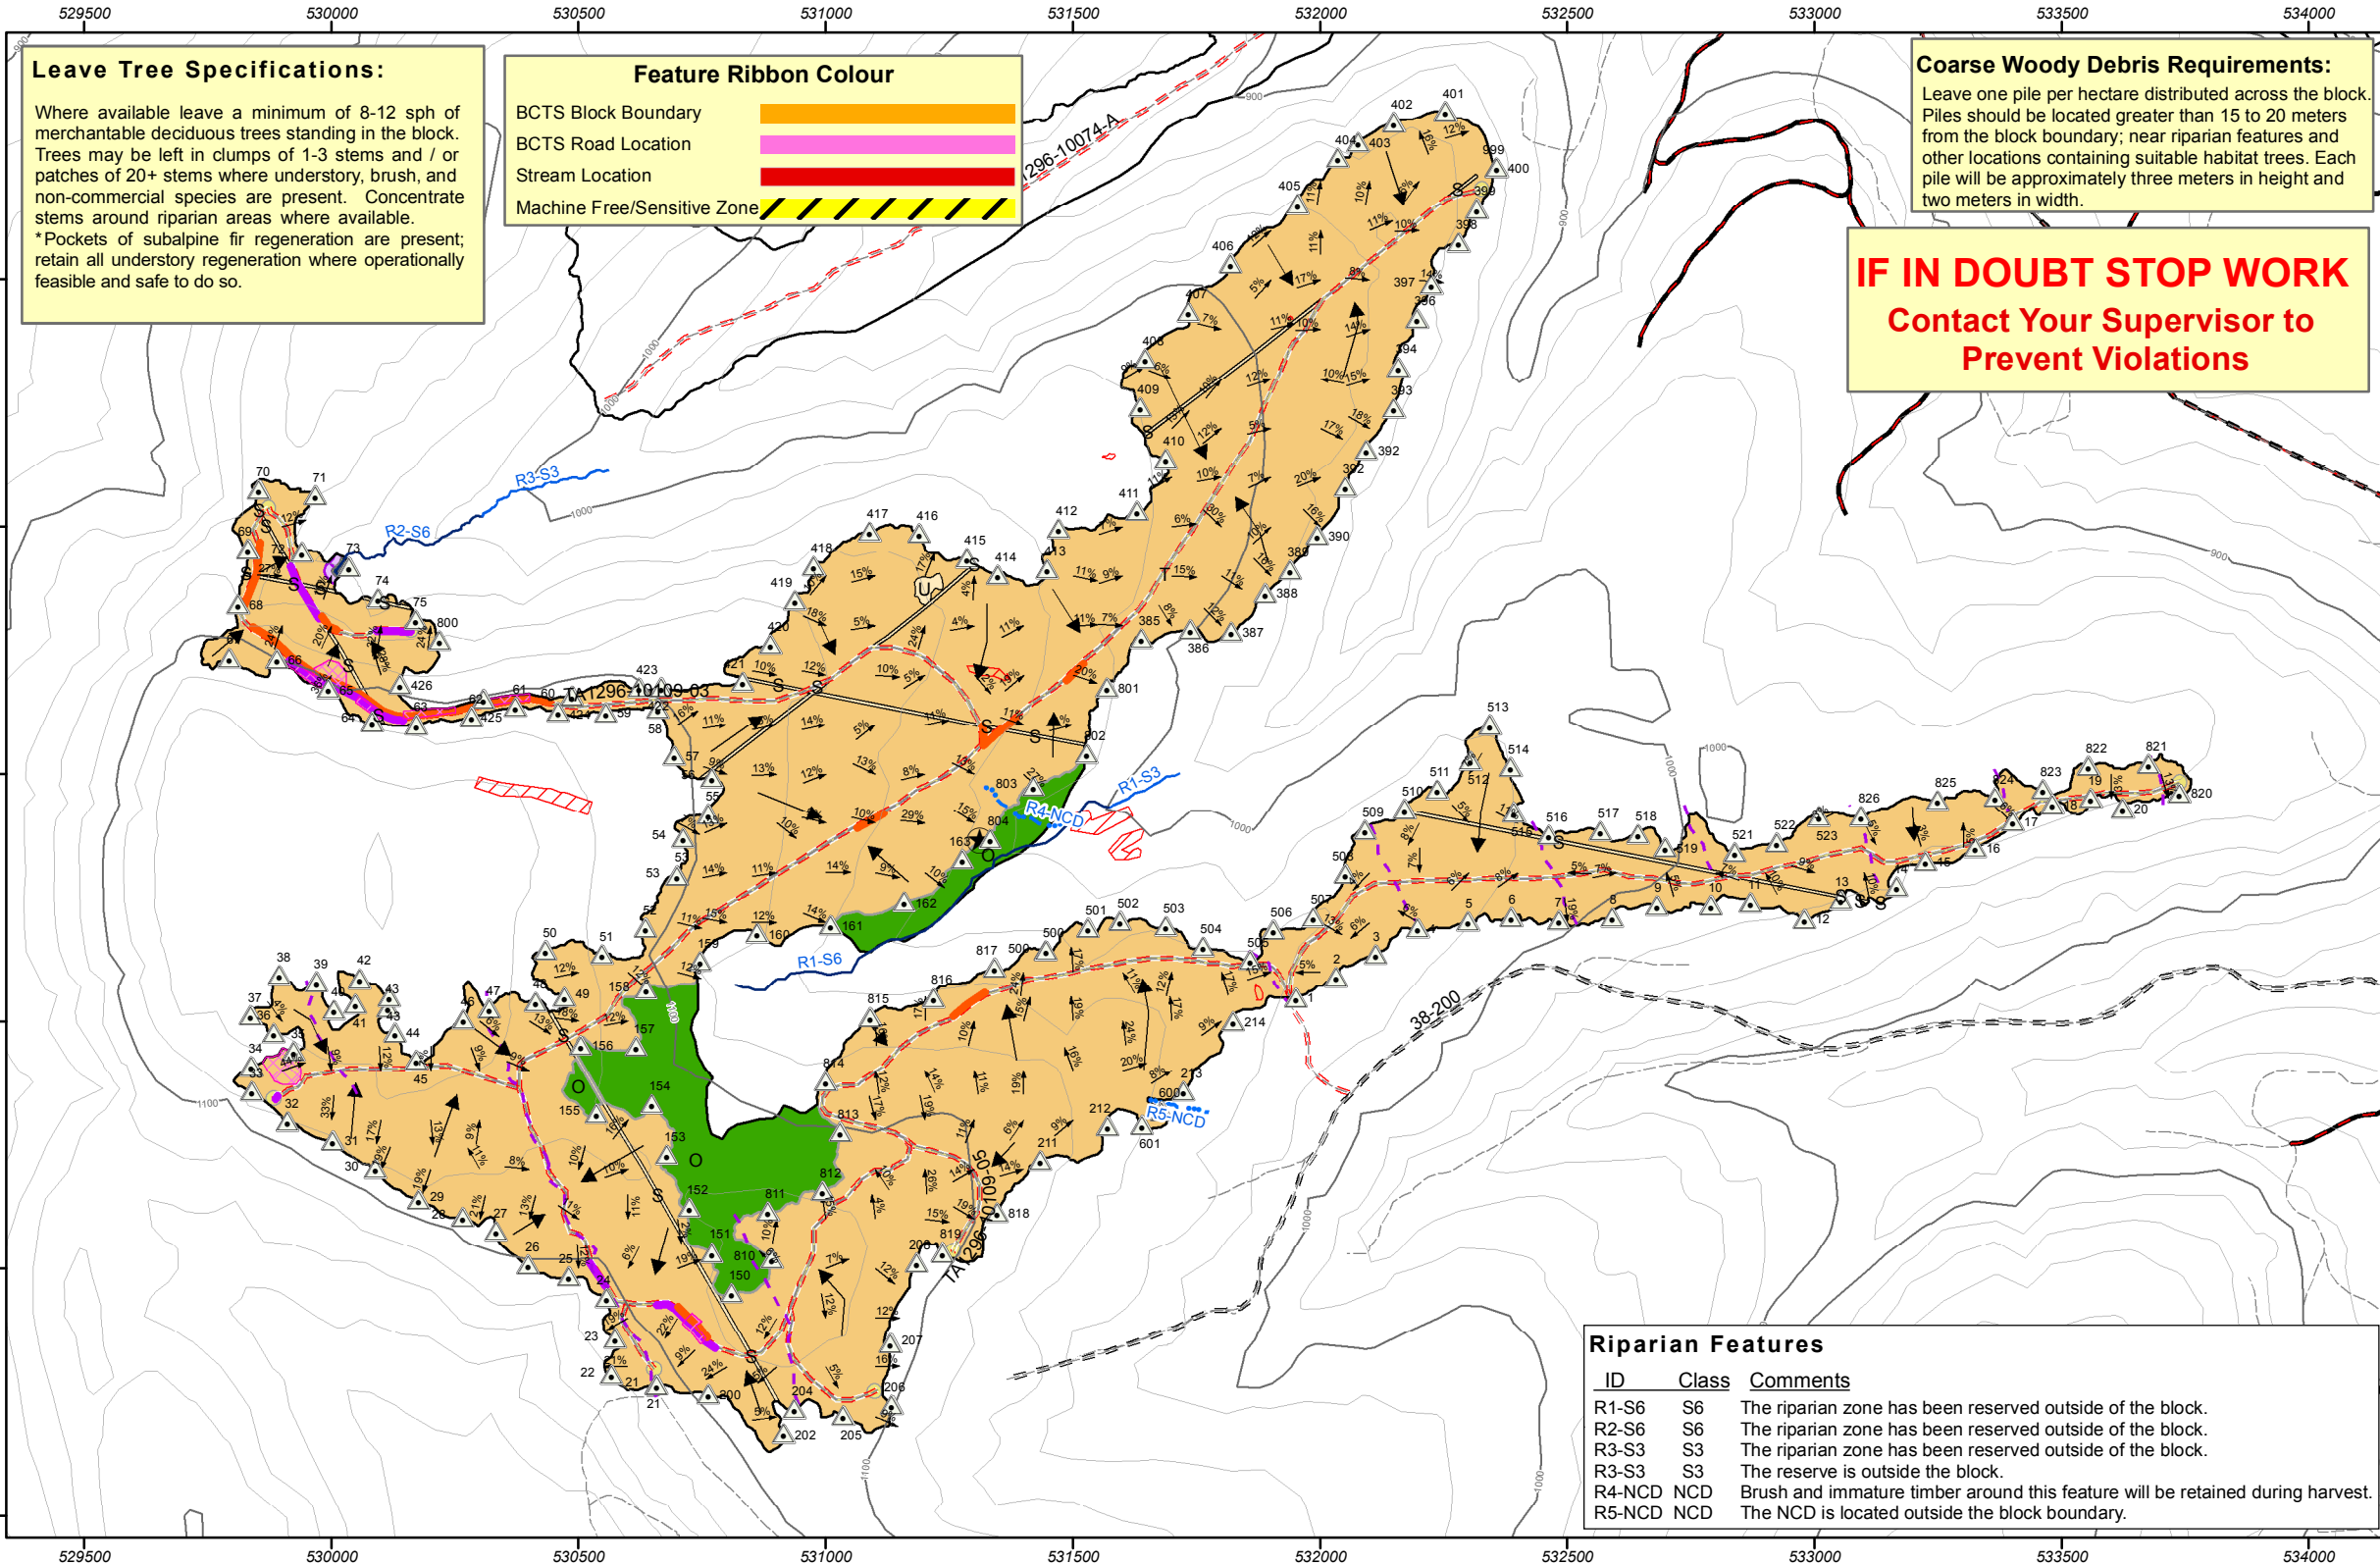

10109 Riparian Crossings
One bridge is required across the access road. The bridge has been designed by Canfor.

10109 Safety Concerns
Maintain natural drainages.
No tree felling activities will occur in timber types 1, 3, 5 during May 25 - July 23 of each year. Chance Find and Stop Work procedures will apply.
Fall away from external WTPs, riparian features, adjacent blocks, and the block boundary.
Slope >35% are found at cruise plots 69 and 164. Utilize caution in this areas.
The northwest corner of this block is accessible via a narrow bench, which has side slopes of >35%.
TA1296-10109-A no decking on the left side from stations 65-70 and stations 74-75 due to steep downhill side slopes.
TA1296-10109-A no decking on the right side from stations 66-69 due to steep uphill side slopes.
TA1296-10109-A no decking on the right side from stations 29-31, stations 104-105, stations 112-114, and stations 117-118 due to steep downhill side slopes.
TA1296-10109-02 no decking on the left side from stations 16-17 due to steep downhill side slopes.
TA1296-10109-03 no decking on the right side from stations 1-3, stations 22-36, and stations 37-39 due to steep downhill side slopes.
TA1296-10109-03 no decking on the left side from stations 23-27 and stations 28-34 due to steep uphill side slopes.
TA1296-10109-04 no decking on the left side from stations 4-6, station 7-8, and stations 13-15 due to steep downhill side slopes.
TA1296-10109-04 no decking on the right side from stations 8-10 due to steep uphill side slopes.

10109 Harvest Constraints
This block is located within a mapped Caribou Herd Range. To minimize ground disturbance, winter harvest with frozen snow covered ground conditions. Limit herbicide use. Prescribe road deactivation and visual buffers to minimize potential pressure on caribou populations. No lichens were found during development. Pockets of subalpine fir regeneration are present; retain all understory regeneration where operationally feasible and safe to do so.
Harvesting within Area of Special Concern is scheduled to occur under winter conditions with snowpack to prevent ground disturbance or via reaching in with the machinery and leaving tree stumps intact.

Harvest Plan Map

TSL TA1296	Block ID 10109
Business Area Peace-Liard	UBI BD301
Operating Area Blue Grave Creek	Location Simpson / Bluegrave
Management Unit Fort St John	FIZ L
Gross Block Area (ha) 242.7	Geographic Center Latitude Longitude 56 32 41 -122 29 29

Unit	Area	Season	Method	Strategy
1	223.0	Winter Only	Ground	Coniferous Leading Species

Contour - Index

Contour - Intermediate

BCTS Blocks

BCTS Roads - All

Road Permit

Forest Service Road

Highway/Freeway

Paved Road

Trail

Resource Road

Gravel or Unimproved Road

Snow Shed (Railway)

Tunnel

Bridge

Airstrip

Rail Line

Cable

Falling Corners

Block Centre

Slope Arrow

TPL BCTS Stream Name-Class Labels

Transmission Line

Pipeline

Pipeline RoW Surveyed

Recreation Site

Recreation Trail

Recreation Area

River or Stream - Definite

River or Stream - Dry/ Indefinite

Flooded Land

Marsh

Swamp

Watercourse

Tailing Pond

Lake

Reservoir

Private Land

Protected Areas & Prov Parks

BCTS Polygon Features

FEATURE_TYPE

Slope Area (>35%)

BCTS Riparian Features

Riparian Features

Machine Free Zone

Riparian Management Zone

BCTS SU-Other Fill

Standard Unit Type

Reserve

Non-Prod Permanent Access

Other

BCTS Harvest Units-Fill

Harvest Unit ID

1; A

BCTS Streams Class

Stream Class

INT; NCD

S1; S2; S3; S4; FSF

S5; S6

BCTS Line Features

Skid Direction Arrow

Old Skid Trail

Area of Special Concern

Decking Restrictions

Left

Right

BCTS Roads - Road State RE

BCTS Roads - Road State

Existing Road

Proposed Road

0 150 300 450 600 750

Meters

1:15,000

Date 2021-03-04 User SHAMACK

Template Name HarvestPlanMap_11x17L

Coordinate System NAD 1983 UTM Zone 10N