



BC Ministry of Forests and Range

Major Culvert Inspection Report

Page 1 of 2
Date Printed: 2016/01/04
User Id: IDIRJOLMSTED
Database: PROD
Report Id: CBR001C
File:

Structure #:	G1-730	Site #:	G1-730	Road Name:	WALKER FSR	Inspection Date:	2015/08/19
KM:	51.50	User km:	51.50	Crossing Name:	Unnamed creek	Next Inspection Date:	2018/08/19
Project File ID #:	3112	Br.	01	Forest District:	Prince George Natural Resource District		
Culvert Type:	Round			Culvert Material:	Corrugated Steel		
Inlet Cover (mm):	300			Outlet Cover (mm):	300		
Footing Type:				Gradient (%):			
Culvert Length (metres):	8.0	Opening Height (mm):	1,200	Opening Width (mm):	1,200		
UTM Zone:	10	UTM Easting:	654451	UTM Northing:	5978226		
Inspector Name:	Joe Vanderzwan			Year Superstructure Installed:	1995		
Access:	Suspect the site is actually 200m or 500m upchainage.						

APPROACHES

Alignment	Good	
Bridge Ahead Signs Missing	0	
Brushing Required	No	
Delineator Missing Left (approaching structure)	0	
Delineator Missing Right (approaching structure)	0	
Fender Condition	None	
Posted Load Rating	none	
Road Surface	Fair	


CULVERT ELEMENT

Baffles	Not Applicable	
Bolted Connections	Not Applicable	
Coupled Connections	Good	
Coating	Fair	Floor rusting
Embedment Materials	Not Applicable	
Fill	Good	
Floor	Good	
Footing	Not Applicable	
Head Wall	Not Applicable	
Inlet	Good	
Outlet	Fair	Minor dent in outlet

Corporate Bridge Register (CBR)

Disclaimer:

- 1) Structure and site information is current at the time of report creation and may have changed since the inspection was submitted and/or accepted.
- 2) Historic Load Rating data not available, contact FLNRO Regional Office for detailed information.

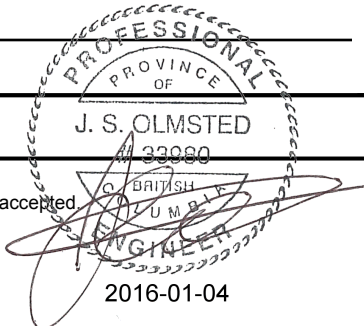



BC Ministry of Forests and Range

Major Culvert Inspection Report

Page 2 of 2
Date Printed: 2016/01/04
User Id: IDIRJOLMSTED
Database: PROD
Report Id: CBR001C
File:

Structure #:	G1-730	Site #:	G1-730	Road Name:	WALKER FSR	Inspection Date:	2015/08/19			
Overall	Good									
Riprap	Fair									
Roof	Good									
Side Walls	Good									
Trash Rack	Not Applicable									
Wiers/Backwater Structures	Not Applicable									
Wing Wall	Not Applicable									
CHANNEL	Estimated Present Water Level Depth:	0.2	Estimated Present Water Level Width:	1.2						
	Estimated High Water Level Clearance:	0.8								
HAZARDS	High Water:	No	Scour:	No	Ice:	No	Debris:	No	Aggradation:	No
	Comment:									
REPAIRS	#	Status	Priority	Estimate	Description					
MONITORS	#	Description								
GENERAL	Inspector's Comment:	Culvert is only 8 meters in length.								
GENERAL	PEng's Comment:									
GENERAL	Replacement Date for full log haul traffic (year):	2035	Replacement Date for light vehicle traffic (year):							
	Current Inspection Load Rating:	41	Design Load GVW (tonnes):	41	Design Vehicle Config.:					
	Professional Inspection Required?	No	Report Status:	Reviewed By Jason Olmsted on 1/4/2016 2:23:27PM						

Corporate Bridge Register (CBR)

Disclaimer:

- 1) Structure and site information is current at the time of report creation and may have changed since the inspection was submitted and/or accepted.
- 2) Historic Load Rating data not available, contact FLNRO Regional Office for detailed information.